


# **GREEN-I**

Catalogue Number(s): 0 484 63/65

# GI-MRW-D / GI-MRB-D MINI RECESSED DALI LIGHTING CONTROL SENSOR

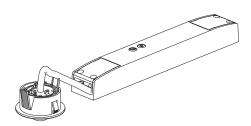

0 484 63 (White) 0 484 65 (Black)

| 1. Use 1                     |
|------------------------------|
| 2. Technical characteristics |
| 3. DIMENSIONS                |
| 4. Connection                |
| 5. Installation              |
| 6. Settings 6                |
| 7. COVERAGE PERFORMANCE 8    |
| 8. FONCTIONNEMENT 8          |
| 9. Maintenance9              |
| 10 STANDARDS                 |

#### 1. USE

This miniature PIR (passive infrared) presence detector provides automatic control of lighting loads with optional manual control. This model can be used for switching control of incandescent, fluorescent and compact fluorescent loads. The unit detects movement using a PIR sensor and turns the load on. When an area is no longer occupied, the load will switch off after an adjustable timeout period.

These units come complete with accessories allowing flush mounting in suspended ceilings or surface mounting on ceilings, or side mounting on a luminaire.

It is quick and easy to set, using potentiometers or an IR remote control (0 484 75)

Time Delay: 10sec to 30min Light Level Setpoint: 5... 2000lux

# 2. TECHNICAL CHARACTERISTICS

# ■ 2.1 Technical data

Voltage: 100-240V AC Frequency: 50 / 60 Hz

No-load power consumption: 0.1W

Output by normally open contact connected to phase

Terminal capacity: 1,5mm<sup>2</sup> Flush-mounting diameter: 40 mm

Weight: 106.9g Impact resistance: IK04

Penetration by solid bodies and liquids: IP20 Operating temperature: -5°C to +30°C Storage temperature: -20°C to +70°C

# 2. TECHNICAL CHARACTERISTICS (Continued)

CONTENTS

#### ■ 2.2 Features

Power Supply:

The relay output dedicated to lightings, switching loads at the zero crossing.

The connections for an auxiliary switch that can be used to turn on the lighting manually.


The trimmer which is used time delay setpoint and daylight level setpoint


Sensor Head

The sensor (pyroelectric technology) with its lens for sensing movement. The daylight sensor measuring the natural and artificial light for driving lightings according to the daylight setpoint.

The Infrared protocol to configure.

- o Time delay
- o Daylight setpoint
- o Launch test mode
- o PIR Sensitivity

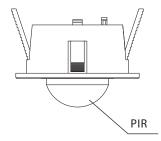

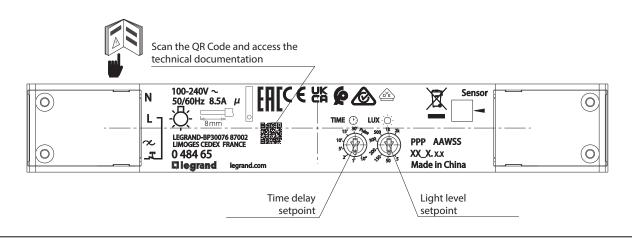

# 2. TECHNICAL CHARACTERISTICS (Continued)

#### ■ 2.3 Load

Control DALI lightings in broadcast and providing DALI power for 30 DALI ballasts


Ballast number (guaranteed): 20

Ballast number (max): 30


Output current (guaranteed): 56mA / 16V Output current (max): 75mA / 16V

# 3. DIMENSIONS

# ■ 3.1 Sensor head

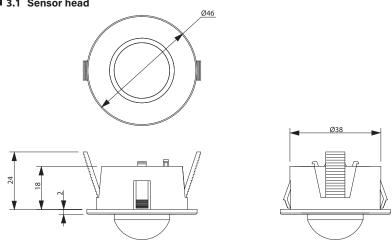

# ■ 3.2 Power supply

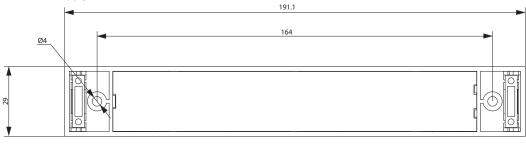




# 4. CONNECTION

Wire the products as shown in the diagram

The auxiliary switch is optional. It can be used to switch the lighting on and off.

# ■ 4.1 Wiring with auxiliary control

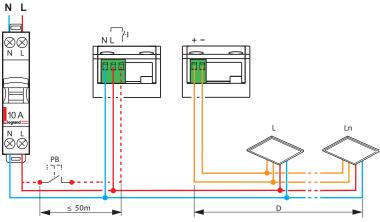

**Bus DALI / DALI Bus** 

| D       |                      |
|---------|----------------------|
| ≤ 100 m | 0.5 mm <sup>2</sup>  |
| ≤ 150 m | 0.75 mm <sup>2</sup> |
| ≤ 300 m | 1.5 mm <sup>2</sup>  |

Technical data sheet: 000000694\_EN-01 Updated: 14/08/2025 Created: 26/06/2025

CONTENTS 2/7

# 5. INSTALLATION **(4)** 50mm $\Theta$ **(1)**

setpoint

# GI-MRW-D / GI-MRB-D MINI RECESSED DALI LIGHTING CONTROL SENSOR

# TIME LUX - 15' 30' 45' 500 1k 2k 10' 5' 2' 1' 10" 450 50 5

Time delay setpoint

# ■ 6.1 Setting by Trimmer

The product is set with this trimmer's positions.

**Time delay setpoint:** Time for which light is switched on following detection.

**Light level setpoint:** Light level setpoint value below which the light is switched on and above which the light is switched off.

|          |                  | ,                  |
|----------|------------------|--------------------|
| Position | Trimmer daylight | Trimmer time delay |
| 1        | 5 lux (Min)      | 10 sec             |
| 2        | 50 lux           | 1 min              |
| 3        | 150 lux          | 2 min              |
| 4        | 200 lux          | 5 min              |
| 5        | 300 lux          | 10 min             |
| 6        | 500 lux          | 15min              |
| 7        | 1000 lux         | 30 min             |
| 8        | 2000 lux (Max)   | 45 min             |


<u>Light level Max:</u> Light will always be turn on/off no matter light level. <u>Pulse:</u> The relay output is driven with short pulse (1s) spaced to 10s for driving a timer lag switch. Combined with a remote time-switch, the detector is ideal for stairwells and corridors.

The time set on the time switch determines how long the load is switched on following a signal detection.


#### **Factory Settings:**

Trimmer daylight: position 8 (max) Trimmer time delay: position 1 (10sec)

# ■ 6.2 Setting by Infrared remote control (Cat. N° 0 484 75)

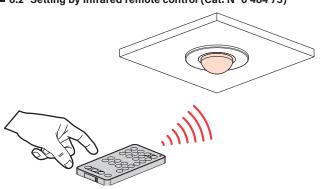

#### ■ 6.2 Setting by Infrared remote control (continued)

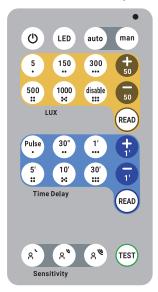

# Notes 1: Auto on/Auto off mode:

Automatic switch-on:

- On detection of presence if the natural light level is insufficient. Automatic switch-off:
- If no presence is detected and at the end of the set time delay
- Or if the natural light level is sufficient

Another detection causes automatic switch-on if there is insufficient light.

#### Notes 2: Manual on/Auto off mode:

Manual switch-on, automatic switch-off:

- When no presence is detected and at the end of the set time delay. After switch-off, any new detection within a 30 second period triggers an automatic switch-on.

After 30 seconds the device is switched on via a manual switch.

#### Note 3: Test Mode:

This mode bypass parameters for 10 minutes.

Every detection switch ON the motion LED (in purple) for 1sec and drives the lightings for 5 seconds.

After these 5 seconds, if no motion is sensed, the lightings turn OFF, else the 5 seconds delay is refreshed (test mode restarts).

The 10 minutes test timer is reset only if remote control test button is pushed again.

CONTENTS 4/7

# **GREEN-I**

# GI-MRW-D / GI-MRB-D MINI RECESSED DALI LIGHTING CONTROL SENSOR

# 6. SETTINGS (Continued)

# ■ 6.2 Setting by Infrared remote control (continued)

| TYPE                    | KEY      | NAME                              | DESCRIPTION   | Comment  |
|-------------------------|----------|-----------------------------------|---|--|
|                         | 0        | Load ON/OFF                       | Turn ON/OFF the connected loads   |  |
| Parameter               | LED      | Motion<br>LED ON/OFF              | Enables or Disables the motion detection<br>LED (green)   | After the setting is successful, the purple LED on the   |
| rarameter               | auto     | Auto ON<br>Auto OFF               | The load will be switched on and off automatically  | product blinks quickly three times.  |
|                         | man      | Manuel ON<br>Auto OFF             | Only pressing the auxiliary control allows the load to be switched on or off manually               |  |
|                         | 5.       | 5 LUX                             | Set light level to 5 LUX  |  |
|                         | 150      | 150 LUX                           | Set light level to 150 LUX  |  |
|                         | 300      | 300 LUX                           | Set light level to 300 LUX  |  |
|                         | 500      | 500 LUX                           | Set light level to 500 LUX  |  |
| Light level<br>Setpoint | 1000     | 1000 LUX                          | Set light level to 1000 LUX   |  |
|                         | disable  | Disable light level<br>Regulation | Light will always be turn on/off no matter light level  |  |
|                         | READ     | Read light level                  | Upon activation the sensor yellow LED will<br>blink «x» times to indicate the set values for<br>LUX | Exemple : the sensor's LED blinks yellow 3 times = light level is set to 300 LUX or the closest value (250 or 350 LUX).  |
|                         | + 50     | Increase 50 lux                   | Increase by 50 LUX the set LUX level  |  |
|                         | 50       | Decrease 50 lux                   | Decrease by 50 LUX the set LUX level  |  |
|                         | Pulse    | Pulse                             | Activate the pulse function on the sensor   |  |
|                         | 30"      | 30 seconds                        | Set time delay to 30s   |  |
|                         | 1        | 1 minute                          | Set time delay to 1min  |  |
|                         | 5'::     | 5 minute                          | Set time delay to 5min  |  |
| Time delay              | 10'      | 10 minute                         | Set time delay to 10min   |  |
|                         | 30'      | 30 minute                         | Set time delay to 30min   |  |
|                         | READ     | Read time delay                   | Upon activation the sensor blue LED will blink «x» times to indicate the set values for time delay  | Exemple : the sensor's LED blinks blue 4 times = time delay is set to 5minutes or closest value (4 min or 6 min).  |
|                         | +        | Increase 1 minute                 | Increase by 1min the set the time delay   |  |
|                         | 1'       | Decrease 1 minute                 | Decrease by 1min the set the time delay   |  |
| Senstivity              | 8, 8, 8, | PIR sensitivity                   | 1.Low<br>2.Medium<br>3.High   | Factory settings: medium   |
| Test Mode               | TEST     | Test Mode                         | Test mode is activated during 10min and the time delay is 5s.                                       | Temporary sets values to: LUX disabled Delay 5s After test period, values return to their original settings and the test can be interrupted by pushing the button once more. |

CONTENTS 5/7

# 6. SETTINGS (Continued)

# ■ 6.3 Pilot lamp feedback

Motion LED feedback:

| STATE                | DESCRIPTION                         |  |
|----------------------|-------------------------------------|--|
| For 45s              | Warmup state (state after power ON) |  |
| For 1s Motion sensed |                                     |  |
| For 1s               | Motion sensed during test mode      |  |

#### Read mechanism feedback

| STATE   | DESCRIPTION  |
|---------|--|
| Blink   | Blinks X times to indicate the set values for TIME DELAY triggered by READ function. |
| O Blink | Blinks X times to indicate the set values for LUX triggered by READ function.        |

#### IR frame ACK feedback:

| STATE                      | DESCRIPTION   |  |  |
|----------------------------|---|--|--|
| ● 3 blinks                 | Blinks quickly 3 times anytime a message is received from remote                            |  |  |
| <ul><li>3 blinks</li></ul> | Blinks quickly 3 times when the message coming from the remote cannot be taken into account |  |  |

#### ■ 6.4 WARM UP

When powered on the motion sensor is in warmup state for 45s: Load is ON;

Green Motion LED is ON;

AUX functions is active;

Infrared remote control/trimmer settings are active;

PIR Sensor is inactive;


LUX level sensing is inactive;

# 7. COVERAGE PERFORMANCE

Factory setting: "Medium Sensitivity" for a height of 2.5m and a temperature of 20  $^{\circ}\text{C}.$ 

# ■ 7.1 Radial movement



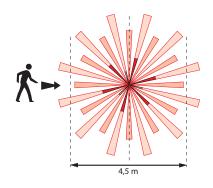


| Height | Sensitivity Low | Sensitivity Medium | Sensitivity High |  |
|--------|-----------------|--------------------|------------------|--|
| (m)    | Ø (m)           | Ø (m)              | Ø (m)            |  |
| 2.5    | 4               | 4.5                | 5                |  |
| 3.5    | 4.5             | 6                  | 7                |  |
| 4      | 5               | 6                  | 7.5              |  |

# 7. COVERAGE PERFORMANCE (Continued)

#### ■ 7.2 Tangential movement



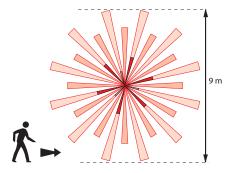

| Height | Sensitivity Low | Sensitivity Medium | Sensitivity High |
|--------|-----------------|--------------------|------------------|
| (m)    | Ø (m)           | Ø (m)              | Ø (m)            |
| 2.5    | 7               | 9                  | 10               |
| 3.5    | 7               | 9                  | 12               |
| 4      | 7               | 10                 | 12.5             |

#### Remark:

For an optimal trigger, the movement must be done perpendicular to the detector. In case direct and frontal approach, the detection of a movement will be harder, and scope will be therefore much lower.

# 8. FONCTIONNEMENT

#### ■ 8.1 More than one sensor and more than one load





inversion of the state of the loads: < 1

| ⊗L1 OFF<br>⊗L2 OFF<br>⊗Ln OFF      | S1 OFF |                | L1 ON 100%  L2 ON 100%  Ln ON 100% | S1 ON  |
|------------------------------------|--------|----------------|------------------------------------|--------|
| L1 ON 100%  L1 ON 100%  Ln ON 100% | S1 ON  | <b>BP</b> < 1s | ⊗L1 OFF<br>⊗L2 OFF<br>⊗Ln OFF      | S1 OFF |

# 8. FONCTIONNEMENT (Continued)

# ■ 8.1 More than one sensor and more than one load (continued)

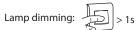

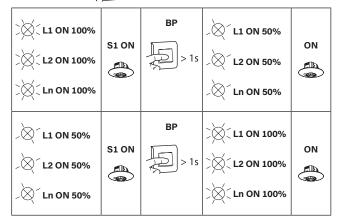

# 9. MAINTENANCE

Ensure the lens remains clean.

Surface cleaning using a cloth.

Do not use: acetone, tar remover, trichloroethylene.

Resistant to the following products:

- Hexane (EN 60669-1),
- Methylated spirit,
- Soapy water,
- Diluted ammonia
- Bleach diluted to 10%,
- Window cleaning products.

**WARNING:** Conduct preliminary tests before using any other specific cleaning products.

# 10. STANDARDS

LVD: Low Voltage Directive Directive: 2014/35/EU Standard: IEC 60669-2-1

EMC: Electromagnetic Compatibility Directive: 2014/30/EU

Product standards: IEC 60669-2-1

IEC 61000-3-2

ROHS: Restriction of Hazardous substances,

Directive:2011/65/EU of 08 June 2011 amended by 2015/862 of

31 March 2015 (ROHS 2) Standard: EN IEC63000

CONTENTS 7/7